Solid State Sensors Digital Position Sensors


Digital



FEATURES

- Completely enclosed housing
- Color coded leadwires
- High speed, no-touch operation over 100 kHz possible
- Adjustable mounting
- Reverse polarity protection (bipolar listing)
- Meets NEMA 3, 3R, 3S, 4, 4X, 12 and 13 requirements
- Bushing is PBT (Valox 420 SEO) 30% glass filled

MOUNTING DIMENSIONS

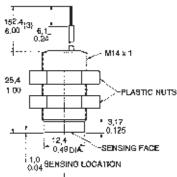






(For reference only)

| 24AWG | Leadwire color code: |
|-------|----------------------|
| Red | Vs (+) |
| Green | Output |
| Black | Ground (-) |

MOUNTING BRACKETS 1SR14M





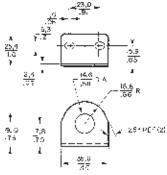

SR3 ORDER GUIDE

| Catalog Listings | | SR3F-A1 | SR3B-A1 | SR3G-A1 | SR3C-A1 | SR4P2-A1 | |
|------------------------------|----------------------------|--------------|------------------|------------------|------------------|------------------|----------------|
| Supply Voltage (VDC) | | 4.5 to 24 | 4.5 to 24 | 4.5 to 24 | 4.5 to 24 | 6 to 24 | |
| Supply Current (mA max.) | | 18.0 | 15.0 | 22.0 | 19.0 | 13.5 | |
| Output Type | | Sink | Sink | Sink | Sink | Sink | |
| Output Voltage (V max.) | | 0.40 | 0.40 | 0.40 | 0.40 | 0.40 | |
| Current per Output (mA max.) | | 10 | 10 | 10 | 10 | 20 | |
| Magnetics Type | | Unipolar (1) | Bipolar (2) | Unipolar (1) | Unipolar (1) | Omnipolar (3) | |
| Magnetic Cha | ar. & Temp. –40 to 85°C | Max. Op. | G mT 450 45.0 | G mT 150 15.0 | G mT 430 43.0 | G mT 190 19.0 | G mT 25 2.5 |
| | (–40 to +185°F) | Min. Rel. | 170 17.0 | -150 -15.0 | 160 16.0 | 60 6.0 | 5 0.5 |
| | - | Min. Dif. | 20 2.0 | 40 4.0 | 50 5.0 | 10 1.0 | 7 0.7 |
| | 25°C (+77°F) | Тур. Ор. | 400 40.0 | 90 9.0 | 350 35.0 | 150 15.0 | 15 1.5 |
| | Typical | Typ. Rel. | 185 18.5 | - 90 - 9.0 | 280 28.0 | 100 10.0 | 11 1.1 |
| | - | Typ. Dif. | 20 2.0 | 80 8.0 | 70 7.0 | 30 3.0 | 4 0.4 |

(1) A unipolar sensor has a plus maximum operate point and a plus minimum release point. One magnetic pole (south) is required to operate and release a unipolar sensor.

(2) A bipolar sensor has a plus (south pole) maximum operate point and a minus (north pole) minimum release point. Operate and release points can be both positive, or both negative. Latching cannot be guaranteed. Ring magnets are usually used with bipolar sensors.

(3) An omnipolar sensor operates with any magnetic field (north or south pole).

(4) Operating characteristics are from -20°C to +85°C for SR4P2-A1.

(5) To order 1 meter jacketed leads, replace the 1 at end of listing with a 2.

Example: SR3B-A2.

G = Gauss

mT = milliTesla